

ADDIGON AND COM					
ADDISON AIRPORT BUILDING REPORT					
Facility Information:		Facility Name: 4551 Glenn C	urtiss Drive		
Facility Contact: Li	sa Pyles	<b>Contact Phone:</b> 972-450-2878			
Accessology Inspector Inf	formation:				
Inspector: Ka Email: Kj	aren Jackson jackson@accessology.com	D	ate: May 3, 2017		
Latitude: 32	2.970644	<b>Longitude:</b> -96.833811			
Address: 45	551 Glenn Curtiss Drive	City: Addison	County: Dallas		
Total Parking Spaces: Total Accessible Parking Number of van accessible Is the accessible parking	e spaces:		10 0 0 N/A		
Violation #1:	nere are no accessible parkin	g spaces provided at this building.			
Standard:	2010 ADAAG 208.1 G	Seneral.			
Text:	Where parking spaces a accordance with 208.	are provided, parking spaces shall be	e provided in		
Possible Solutions:	Add one van accessible parking signage.	e parking space, an access aisle and o	compliant van		

	ADDISON AII	ADDISON AIRPORT - 4551 Glenn Curtiss Drive Parking - Page 2		
Violation #1 Cost:	\$3,150 ·	Priority Level 3		
		High Priority 1-4		
Parking Violations Total	\$3,150	Medium Priority 5-8		
		Low Priority 9-12		

ADDISON AIRPORT BUILDING REPORT				
Facility Information:		Facility Name: 4551 Glenn Cu	rtiss Drive	
Facility Contact: Lis	a Pyles	<b>Contact Phone:</b> 972-450-2878		
Accessology Inspector Info	ormation:			
<b>Inspector:</b> Kar <b>Email:</b> Kja	ren Jackson ackson@accessology.com	Da	<b>te:</b> May 3, 2017	
Latitude: 32.9	970644	<b>Longitude:</b> -96.833811		
Address: 455	51 Glenn Curtiss Drive	City: Addison	County: Dallas	
General Accessible Route	Notes:			
The	e route from parking to the e	ntrance is not compliant.		
Is the path of travel from bentrance substantially com	e ground around the entrance ne places.  2010 ADAAG 302.1 Ge	e is cracked and uneven with gaps up		
Possible Solutions:	Remove and replace pav	ving to achieve a smooth transition.		
Violation #2 Cost:	\$1,575	Priority Level 4		
Accessible Route Total	\$1,575	High Priority  Medium Priority  Low Priority	ity 5-8	

ADDISON AIRPORT BUILDING REPORT				
Facility Information:		Facility Name: 4551 Glenn	Curtiss Drive	
Facility Contact:	Lisa Pyles	<b>Contact Phone:</b> 972-450-287	78	
Accessology Inspector	Information:			
-	Karen Jackson Kjackson@accessology.com	1	<b>Date:</b> May 3, 2017	
Latitude:	32.970644	<b>Longitude:</b> -96.833811		
Address:	4551 Glenn Curtiss Drive	City: Addison	County: Dallas	
General Entrance Note	es:			
	The entrance into this facility is	not compliant.		
Is the main entry door Is there an alternate do If so, does the inaccess of the nearest accessible	oor that is accessible? ible door have signage indicati le door?	ng the location vering clearance on the pull side o	No No N/A	
Violation #3: Standard:	door as the pavement drops off	-		
Text:	Swinging doors and gate with Table 404.2.4.1.	es shall have maneuvering clearar	nces complying	
Possible Solutions:	Reconstruct exterior of c	loor to provide a 60" deep level la	anding.	
Violation #3 Cost:	\$2,625	Priority Level 4		
Entrance Total	\$2,625	High Prior	<u> </u>	

ADDISON AIRPORT BUILDING REPORT				
Facility Information:		Facility Name: 4551 Glenn Cur	rtiss Drive	
Facility Contact: Li	sa Pyles	<b>Contact Phone:</b> 972-450-2878		
Accessology Inspector In	formation:			
Inspector: Karen Jackson  Email: Kjackson@accessology.com  Date: May 3, 2017				
Latitude: 32	2.970644	<b>Longitude:</b> -96.833811		
Address: 45	551 Glenn Curtiss Drive	City: Addison	County: Dallas	
General Hallway Notes:				
Tł	nis facility includes hallways.	Eight of the doors have non-complia	ant hardware.	
Does this facility have any Do the doors have complied the doors have proper Is the hallway width at less Are visual strobes provide Are there any protruding Is the signage substantial	iant hardware? maneuvering clearances? ast 36" clear width? ed? g objects?		Yes No Yes Yes No No No No	
Violation #4:  There are 8 interior doors with door hardware that requires grasping and twisting to operate.				
Standard:	2010 ADAAG 404.2.7 I	Door and Gate Hardware.		
Text:	Handles, pulls, latches, locks, and other operable parts on doors and gates shall comply with 309.4.			
Possible Solutions:	Replace door hardware with lever style door hardware.			
Violation #4 Cost:	\$3,150	Priority Level 2		

## ADDISON AIRPORT - 4551 Glenn Curtiss Drive Hallway - Page 2

	Hallway - 1 age 2
iolotion #5.	The vision panel on the door leading into the storage room is at 46-3/8" where 43" naximum is required to the bottom of the vision panel.
andard:	2010 ADAAG 404.2.11 Vision Lights.
xt:	Doors, gates, and side lights adjacent to doors or gates, containing one or more glazing panels that permit viewing through the panels shall have the bottom of at least one glazed panel located 43" maximum above the finish floor.
ssible Solutions:	Replace the door with a compliant vision panel.
ation #5 Cost:	\$2,625 Priority Level 12
lation #6:	The storage room in the warehouse has a 1-3/16" step to enter.
ndard:	2010 ADAAG 303.2 Vertical.
:	Changes in level of 1/4 inch high maximum shall be permitted to be vertical.
ible Solutions:	Modify entrance into the store room so it has a change in level no greater than 1/2".
lation #6 Cost:	\$1,575 Priority Level 9
	High Priority 1-4
llway Total	\$7,350 Medium Priority 5-8

Low Priority 9-12

ADDISON AIRPORT BUILDING REPORT				
Facility Information:	Facility N	Name: 4551 Glenn Cu	artiss Drive	
Facility Contact: Lisa Pyles	Contact P	<b>Phone:</b> 972-450-2878		
Accessology Inspector Information	:			
Inspector: Karen Jackson@a		Da	te: May 3, 2017	
Latitude: 32.970644 Address: 4551 Glenn	9	itude: -96.833811 City: Addison	County: Dallas	
General Restroom Notes:				
	Ien's and a Women's single user r in substantial compliance.	restroom serving this fa	acility. Neither	
Is the door to the restroom substant Does the room have the required to Is the water closet substantially con Does the water closet have the required Is the lavatory substantially compliants the urinal substantially compliants the mirror substantially compliants.	urning radius? mpliant? uired clear floor space? iant? nt?		No	
Violation #7: The Men's re	estroom signage is mounted on th	ne door.		
Standard: 2010	ADAAG 703.1 General.			
Teyt: requi	s shall comply with 703. Where be red, either one sign with both vistate signs, one with visual, and or ided.	sual and tactile charact	ers, or two	
Possible Solutions: Insta	Il compliant signage on the wall	on the latch side of the	e door.	
Violation #7 Cost:	\$525 Prio	ority Level 6		

## ADDISON AIRPORT - 4551 Glenn Curtiss Drive Restrooms - Page 2

Violation #8: The Men's restroom is too small and does not have the required turning radius provided.

Standard: 2010 ADAAG 213.2 Toilet Rooms and Bathing Rooms.

**Text:** Where toilet rooms are provided, each toilet room shall comply with 603.

Possible Solutions:

Enlarge restroom to accommodate accessible water closet, lavatory and wheelchair turning space.

Violation #8 Cost: \$8,400 Priority Level 4

**Violation #9:** The Women's restroom signage is mounted on the door.

Standard: 2010 ADAAG 703.1 General.

Text:

Signs shall comply with 703. Where both visual and tactile characters are required, either one sign with both visual and tactile characters, or two separate signs, one with visual, and one with tactile characters, shall be provided.

**Possible Solutions:** Install compliant signage on the wall on the latch side of the door.

Violation #9 Cost: \$525 Priority Level 6

Violation #10: The Women's restroom is too small and does not have the required turning radius provided.

Standard: 2010 ADAAG 213.2 Toilet Rooms and Bathing Rooms.

	ADDISON AIRPORT - 4551 Glenn Curtiss Drive Restrooms - Page 3	
Text:	Where toilet rooms are provided, each toilet room shall comply with 603.	
Possible Solutions:	Enlarge restroom to accommodate accessible water closet, lavatory and wheelchair turning space.	
Violation #10 Cost:	\$8,400 Priority Level 4	
	High Priority 1-4	
Restrooms Total	\$17,850 Medium Priority 5-8	
	Low Priority 9-12	

		DISON AIRPORT LDING REPORT	
Facility Information:		Facility Name: 4551 Glenn C	Curtiss Drive
Facility Contact: Lisa	a Pyles	<b>Contact Phone:</b> 972-450-2878	3
Accessology Inspector Info	ormation:		
<b>Inspector:</b> Kar <b>Email:</b> Kja	en Jackson ckson@accessology.com	D	ate: May 3, 2017
Latitude: 32.9	970644	<b>Longitude:</b> -96.833811	
Address: 455	1 Glenn Curtiss Drive	City: Addison	County: Dallas
General Break Room Note The	ere is one break room that se	erves this facility.	
Does the facility have a breast list here a stove or cooktop. Is there a sink? Is the sink substantially cooker the counters at 34" aff	? mpliant?		Yes No Yes No No
Violation #11:	breakroom sink is at 35-1/2	2" high where 34" maximum is req	uired.
Standard:	2010 ADAAG 606.3 La	avatories and Sinks Height.	
Text:		all be installed with the front of the 4 inches maximum above the finish	_
Possible Solutions:	Modify sink to provide	34" maximum height.	
Violation #11 Cost:	\$2,100	Priority Level 4	
Break Rooms Total	\$2,100	High Priori Medium Prio Low Priori	5-8

## **Summary Sheet for 4551 Glenn Curtiss Drive**

## 4551 Glenn Curtiss Drive

#	VIOLATION SUMMARY	PRIORITY LEVEL	COST
1	Add one van accessible parking space, an access aisle and compliant van parking signage.	Level 3	\$3,150.00
2	Remove and replace paving to achieve a smooth transition.	Level 4	\$1,575.00
3	Reconstruct exterior of door to provide a 60" deep level landing.	Level 4	\$2,625.00
4	Replace door hardware with lever style door hardware.	Level 2	\$3,150.00
5	Replace the door with a compliant vision panel.	Level 12	\$2,625.00
6	Modify entrance into the store room so it has a change in level no greater than 1/2".	Level 9	\$1,575.00
7	Install compliant signage on the wall on the latch side of the door.	Level 6	\$525.00
8	Enlarge restroom to accommodate accessible water closet, lavatory and wheelchair turning space.	Level 4	\$8,400.00
9	Install compliant signage on the wall on the latch side of the door.	Level 6	\$525.00
10	Enlarge restroom to accommodate accessible water closet, lavatory and wheelchair turning space.	Level 4	\$8,400.00
11	Modify sink to provide 34" maximum height.	Level 4	\$2,100.00

Grand Total \$34,650.00





**Violation 1** - There are no accessible parking provided at this building.




**Violation 2 -** The ground around the entrance is cracked and uneven with gaps up to 1-1/2" in some places.





**Violation 3 -** There is not a 5' level maneuvering clearance on the pull side of the entrance door. The pavement drops off 1/2".

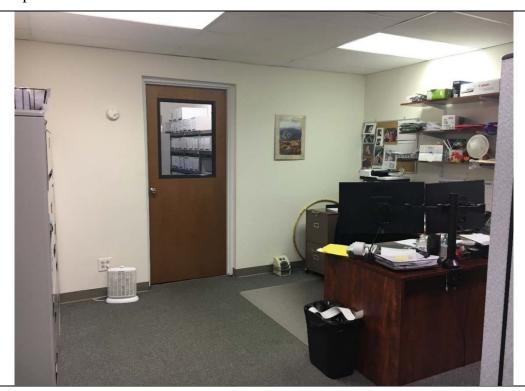


**Violation 4 -** There are 8 interior doors with door hardware that requires grasping and twisting to operate.





**Violation 5 -** The vision panel on the door leading into the storage room is at 46-3/8".

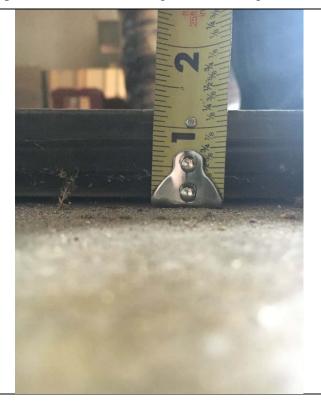


**Violation 6 -** The storage room in the warehouse has a 1-3/16" step to enter.





**Violation 7 -** The Men's restroom signage is mounted on the door.

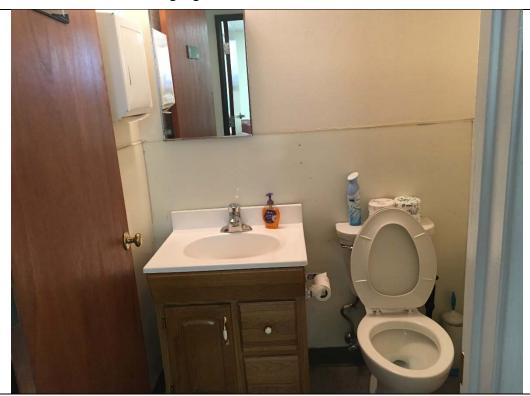


Violation 8 - The Men's restroom is too small and does not have the required turning radius provided.





**Violation 9 -** The Women's restroom signage is mounted on the door.

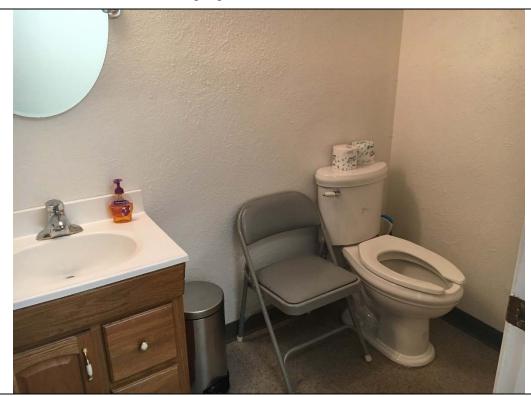

 $oldsymbol{Violation 10}$  - The Women's restroom is too small and does not have the required turning radius provided.





**Violation 11 -** The breakroom sink is at 35-1/2" high where 34" maximum is required.