

TOWN OF ADDISON BUILDING REPORT			
Facility Information:		Facility Name: Police Sul	ostation - Vitruvian
Facility Contact: Lisa	Pyles	Contact Phone: 972-450-2	2878
Accessology Inspector Infor	mation:		
<b>Inspector:</b> Kare <b>Email:</b> Kjacl	n Jackson kson@accessology.com		<b>Date:</b> April 19, 2017
Latitude: 32.93		<b>Longitude:</b> -96.84999	
Address: 4015	Vitruvian Way	City: Addison	County: Dallas
General Parking Notes:			
There build	_	g spaces provided in the parking	g lot adjacent to this
Total Parking Spaces:  Total Accessible Parking Spaces:  Number of van accessible spaces:  Is the accessible parking substantially compliant?  No			0
Violation #1:	e are no accessible parkin	ng spaces provided to serve this p	parking lot.
Standard:	2010 ADAAG 208.2 M	Ainimum Number.	
Text:		ring with 502 shall be provided i required by 208.2.1, 208.2.2, and	
Possible Solutions:  Create one accessible parking space and access an access aisle serving it with accessible signage.		ess aisle serving it	

	TOWN OF ADDISON - Police Substation - Vitruvian Parking - Page 2		
Violation #1 Cost:	\$3,150 ·	Priority Level 3	
		High Priority 1-4	
Parking Violations Total	\$3,150	Medium Priority 5-8	
		Low Priority 9-12	

TOWN OF ADDISON BUILDING REPORT				
Facility Information:		Facility Name: Police Substation	on - Vitruvian	
Facility Contact: Lisa	a Pyles	<b>Contact Phone:</b> 972-450-2878		
Accessology Inspector Info	ormation:			
<b>Inspector:</b> Kar <b>Email:</b> Kja	en Jackson ckson@accessology.com		<b>te:</b> April 19, 2017	
Latitude: 32.9	937526	<b>Longitude:</b> -96.849994		
Address: 401	5 Vitruvian Way	City: Addison	County: Dallas	
		building entrance from the ramp is in sul	bstantial	
Is the path of travel from a Does the path of travel serv Is the path of travel from b entrance substantially com	ve all exterior amenition ouilding entrances to a		Yes N/A N/A	
Violation #2:	ramp leading to the bu	ilding entrance has no edge protection.		
Standard:	2010 ADAAG 405.	9 Edge Protection.		
Text:		inplying with 405.9.1 or 405.9.2 shall be ans and at each side of ramp landings.	provided on	
Possible Solutions:	Add edge protection	1.		
Violation #2 Cost:	\$5,250	Priority Level 4		
Violation #3•	bottom section of the r broken concrete.	ramp where it connects to the parking lot	has uneven	
Standard:	2010 ADAAG 405. ADAAG 302.1 Ger	<del>-</del>	2010	

	TOWN OF ADDISON - Police Substation - Vitruvian Accessible Route Exterior - Page 2
Text:	<ul> <li>2010 ADAAG 405.7.1 Slope Landings shall comply with 302. Changes in level are not permitted. EXCEPTION: Slopes not steeper than 1:48 shall be permitted.</li> <li>2010 ADAAG 302.1 General. Floor and ground surfaces shall be stable, firm, and slip resistant and shall comply with 302.</li> </ul>
Possible Solutions:	Remove and replace the area at the end of the ramp to achieve a smooth transition with changes in level are no greater than 1:48 in all directions
Violation #3 Cost:	\$525 Priority Level 4
Accessible Route Total	High Priority 1-4  \$5,775  Medium Priority 5-8  Low Priority 9-12

		TOWN OF ADDISON BUILDING REPORT	
Facility Information:		Facility Name: Police Substation	on - Vitruvian
Facility Contact: Li	sa Pyles	<b>Contact Phone:</b> 972-450-2878	
Accessology Inspector Inf	formation:		
Inspector: Ka Email: Kj	aren Jackson jackson@accessology.c		<b>te:</b> April 19, 2017
Latitude: 32	2.937526	<b>Longitude:</b> -96.849994	
Address: 40	15 Vitruvian Way	City: Addison	County: Dallas
General Entrance Notes:			
Th	ne entrance into this fac	ility is not compliant.	
Is the main entry door ac Is there an alternate door If so, does the inaccessible of the nearest accessible of	that is accessible? e door have signage in	dicating the location	No No N/A
Violation #4:	nere is a 5.5% running s	slope up to the entrance door.	
Standard:	2010 ADAAG 40	4.2.4.4 Floor or Ground Surface	
Text:		urface within required maneuvering cleara Changes in level are not permitted. Slope all be permitted.	
Possible Solutions:	Modify exterior of area.	f entrance door to provide level maneuver	ing clearance
Violation #4 Cost:	\$2,625	Priority Level 4	
Violation #5:	nere is a 3/8" threshold	at the entrance door.	
Standard:	2010 ADAAG 40	4.2.5 Thresholds	

## TOWN OF ADDISON - Police Substation - Vitruvian Parking - Page 2

Text:

Thresholds, if provided at doorways, shall be 1/2 inch (13 mm) high maximum. Raised thresholds and changes in level at doorways shall comply with 302 and 303.

Possible Solutions:

Modify threshold to achieve a change in level no greater than 1/2".

**Violation #5 Cost:** 

\$525

Priority

Level 4

Violation #6:

There is only a 16-3/8" maneuvering clearance on the pull side of the entrance door, a minimum of 18" maneuvering clearance is required.

Standard:

404.2.4.1 Swinging Doors and Gates.

Text:

Swinging doors and gates shall have maneuvering clearances complying with Table 404.2.4.1.

**Possible Solutions:** 

Modify door to provide 18" minimum clearance on the pull side of the door.

Violation #6 Cost:

\$2,625

Priority

Level 4

Entrance Total

\$5,775

Medium Priority

**High Priority** 

5-8

Low Priority

9-12

TOWN OF ADDISON BUILDING REPORT				
Facility Information:		Facility Name: Police Substa	tion - Vitruvian	
Facility Contact: Li	sa Pyles	<b>Contact Phone:</b> 972-450-2878	3	
Accessology Inspector In	formation:			
Inspector: Ka	aren Jackson	D	ate: April 19, 2017	
<b>Email:</b> Kj	jackson@accessology.co	om		
Latitude: 32	2.937526	<b>Longitude:</b> -96.849994		
Address: 40	015 Vitruvian Way	City: Addison	County: Dallas	
General Hallway Notes:				
Th	nere are no hallways in the town of	his building. Additionally, this is a lease Addison.	e space and is	
Does this facility have an	y hallways?		No	
Do the doors have compli	ant hardware?		No	
Do the doors have proper	_	ces?	No	
Is the hallway width at le			Yes	
Are visual strobes provid			No	
Are there any protruding	•		No	
Is the signage substantial	iy compilant?		N/A	
Violation #7:	nere are four (4) interior	doors with knob hardware.		
Standard:	2010 ADAAG 404.	.2.7 Door and Gate Hardware.		
Text:	Handles, pulls, late shall comply with 3	ches, locks, and other operable parts on 309.4.	doors and gates	
Possible Solutions:	Replace with lever	hardware.		
Violation #7 Cost:	\$1,575	Priority Level 6		
Violation #8:	nere is only a 11" maneuv oor.	vering clearance on the pull side of the	storage room	

	TOWN OF ADDISON - Police Substation - Vitruvian		
	Hallway - Page 2		
Standard:	404.2.4.1 Swinging Doors and Gates.		
Text:	Swinging doors and gates shall have maneuvering clearances complying with Table 404.2.4.1.		
Possible Solutions:	Modify door to provide 18" minimum clearance on the pull side of the door.		
Violation #8 Cost:	\$2,625 Priority Level 12		
	High Priority 1-4		
Hallway Total	\$4,200 Medium Priority 5-8		
	Low Priority 9-12		

TOWN OF ADDISON BUILDING REPORT				
Facility Information:		Facility Name: Police Substa	tion - Vitruvian	
Facility Contact: List	sa Pyles	<b>Contact Phone:</b> 972-450-2878	3	
Accessology Inspector Inf	formation:			
<b>Inspector:</b> Ka <b>Email:</b> Kj	uren Jackson ackson@accessology.co		<b>Pate:</b> April 19, 2017	
Latitude: 32	.937526	<b>Longitude:</b> -96.849994		
Address: 40	15 Vitruvian Way	City: Addison	County: Dallas	
General Restroom Not <u>es:</u>				
Th	ere is one single-user re	estroom provided in this facility.		
Is the door to the restroor Does the room have the ro Is the water closet substant Does the water closet have Is the lavatory substantial Is the urinal substantially Is the mirror substantially Violation #9:	equired turning radius ntially compliant? e the required clear flo lly compliant? compliant?	g is only 30-1/2" wide.	No Yes No Yes Yes Yes N/A Yes	
Text:	openings of doorwa	ll provide a clear width of 32 inches min ays with swinging doors shall be measu d the stop, with the door open 90 degree	red between the	
Possible Solutions:	Modify door to pro	ovide 32" minimum clear width.		
Violation #9 Cost:	\$2,625	Priority Level 4		
Violation #10:	e centerline of the water	r closet is only at 15".		

	TOWN OF ADDISON - Police Substation - Vitruvian		
	Restrooms - Page 2		
Standard:	2010 ADAAG 604.2 Location		
Text:	The water closet shall be positioned with a wall or partition to the rear and to one side. The centerline of the water closet shall be 16 inches minimum to 18 inchesmaximum from the side wall or partition.		
Possible Solutions:	Relocate water closet to provide 16"-18" centerline.		
Violation #10 Cost:	\$2,625 Priority Level 5		
Violation #III	ne grab bars are mounted at 39" above finished floor to the top of the gripping rface.		
Standard:	2010 ADDAG 609.4 Position of Grab Bars.		
	Grab bars shall be installed in a horizontal position, 33 inches minimum and 36 inches maximum above the finish floor measured to the top of the gripping surface.		
Γext:	and 36 inches maximum above the finish floor measured to the top of the		
	and 36 inches maximum above the finish floor measured to the top of the		
Possible Solutions:	and 36 inches maximum above the finish floor measured to the top of the gripping surface.  Remove and reinstall grab bars at 33"-36" to the top of the gripping		
Text: Possible Solutions: Violation #11 Cost:	and 36 inches maximum above the finish floor measured to the top of the gripping surface.  Remove and reinstall grab bars at 33"-36" to the top of the gripping surface.		
Possible Solutions:	and 36 inches maximum above the finish floor measured to the top of the gripping surface.  Remove and reinstall grab bars at 33"-36" to the top of the gripping surface.  \$525  Priority  Level 8		

	TOWN OF ADDISON BUILDING REPORT	
Facility Information:	Facility Name: Police Substa	ntion - Vitruvian
Facility Contact: L	isa Pyles Contact Phone: 972-450-287	8
Accessology Inspector Ir	formation:	
Inspector: K Email: K	aren Jackson I jackson@accessology.com	<b>Date:</b> April 19, 2017
Latitude: 3 Address: 4	2.937526 <b>Longitude:</b> -96.849994 <b>City:</b> Addison	County: Dallas
General Break Room No		
T	he break room provided in this facility does not have a complian	nt sink.
Does the facility have a k Is there a stove or cookto Is there a sink? Is the sink substantially Are the counters at 34" a Violation #12:	op? compliant?	Yes No Yes No No
Standard:	2010 ADAAG Height.	Junier.
Text:	Lavatories and sinks shall be installed with the front of the rim or counter surface 34 inches maximum above the finis ground.	-
Possible Solutions:	Modify sink to provide 34" maximum height.	
Violation #12 Cost:	\$2,100 Priority Level 4	
Violation #13.	he knee clearance is only 4" deep at 27" above finished floor when the family 8" is required.	nere a minimum
Standard:	2010 ADAAG 306.3.3 Minimum Required Depth	

## **TOWN OF ADDISON - Police Substation - Vitruvian Break Rooms - Page 2** Where knee clearance is required under an element as part of a clear floor space, the knee clearance shall be 11" deep minimum at 9" above the Text: finish floor or ground, and 8" deep minimum at 27" above the finish floor or ground. Modify cabinet apron to achieve required knee clearance. The cost of **Possible Solutions:** compliance is included in Violation #12. Level 4 Violation #13 Cost: \$0 **Priority** High Priority 1-4 Break Rooms Total \$2,100 Medium Priority 5-8 Low Priority 9-12

## **Summary Sheet for Police Substation - Vitruvian**

## **Police Substation - Vitruvian**

#	VIOLATION SUMMARY	PRIORITY LEVEL	COST
1	Create one accessible parking space and access an access aisle serving it with accessible signage.	Level 3	\$3,150.00
2	Add edge protection.	Level 4	\$5,250.00
3	Remove and replace the area at the end of the ramp to achieve a smooth transition with changes in level are no greater than 1:48 in all directions	Level 4	\$525.00
4	Modify exterior of entrance door to provide level maneuvering clearance area.	Level 4	\$2,625.00
5	Modify threshold to achieve a change in level no greater than 1/2".	Level 4	\$525.00
6	Modify door to provide 18" minimum clearance on the pull side of the door.	Level 4	\$2,625.00
7	Replace with lever hardware.	Level 6	\$1,575.00
8	Modify door to provide 18" minimum clearance on the pull side of the door.	Level 12	\$2,625.00
9	Modify door to provide 32" minimum clear width.	Level 4	\$2,625.00
10	Relocate water closet to provide 16"-18" centerline.	Level 5	\$2,625.00
11	Remove and reinstall grab bars at 33"-36" to the top of the gripping surface.	Level 8	\$525.00
12	Modify sink to provide 34" maximum height.	Level 4	\$2,100.00
13	Modify cabinet apron to achieve required knee clearance. The cost of compliance is included in Violation #12.	Level 4	\$0.00

Grand Total \$26,775.00







Violation 1 - There are no accessible parking spaces provided to serve this parking lot.







Violation 2 - The ramp leading to the building entrance has no edge protection.












**Violation 3 -** The bottom section of the ramp where it connects to the parking lot has uneven and broken concrete.

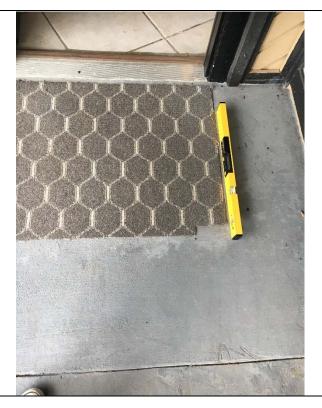

**Violation 4 -** There is a 5.5% running slope up to the entrance door.







**Violation 5** - There is a 3/8" threshold at the entrance door.





**Violation 6 -** There is only a 16-3/8" maneuvering clearance on the pull side of the entrance door, a minimum of 18" maneuvering clearance is required.



**Violation 7 -** There are four (4) interior doors with knob hardware.







**Violation 8 -** There is only a 11" maneuvering clearance on the pull side of the storage room door.





**Violation 9 -** The restroom door opening is only 30.5" wide.



**Violation 10 -** The centerline of the water closet is only at 15".





**Violation 11** – The grab bars are mounted at 39" above finished floor to the top of the gripping surface.



**Violation 12 -** The sink in the break room is at 36" above finished floor to the counter.





**Violation 13 -** The knee clearance is only 4" deep at 27" above finished floor where a minimum of 8" is required.