
Client: Program: KHA No.:	Town of Addison ADA Self-Evaluation and Transition Plan 063543021	Date: 1/2/18 Prepared By: CMP Checked By: EPE				
Corridor : Project Name: Town:	Quorum Dr Intersection of Landmark PI and driveway (Lat. 32.9486; I Addison	Long96.8246)			G	PS ID: 217
Item No.	Item Description	Quantity	Unit	Ur	nit Price	Item Cost
	EXCAVATION (ROADWAY)	0	CY	\$	10.00 \$	-
	CONC CURB (TY II)	0	LF	\$	15.00 \$	-
TxDOT 531-6001	CONC SIDEWALKS (4")	0	SY	\$	45.00 \$	-
TxDOT 531	CURB RAMPS	2	EA	\$	1,500.00 \$	3,000.0
TxDOT 5003-6002	RETROFIT DET WARN SURF (CAST IN PLACE)	0	SF	\$	50.00 \$	-
TxDOT 104-6015	REMOVING CONC (SIDEWALKS)	19	SY	\$	9.00 \$	171.0
TxDOT 677	ELIM EXT PAVE MRK & MRKS	0	LF	\$	2.80 \$	-
TxDOT 666/678	REFL PAV MRK PREP, TY I & TY II (W) 24"(SLD)	0	LF	\$	8.50 \$	-
	REPAVE ROADWAY	0	LS	\$	5,000.00 \$	-
	FIX PONDING	0	LS	\$	2,000.00 \$	-
	FIX CURB RAMP TRANSITION	0	LS	\$	2,000.00 \$	-
	MEDIAN NOSE MODIFICATION	0	LS	\$	5,000.00 \$	-
	REMOVE TEMPORARY OBSTRUCTION	0	LS	\$	500.00 \$	-
	FIX CURB RAMP COUNTER SLOPE	0	LS	\$	2,000.00 \$	-
asis for Cost Proje				Subtotal: \$	3,171.0	
	☑ No Design Completed			ineering: (% +		914.5
	Preliminary Design		Cor	tingency: (% +		914.5
	Final Design			Estimated	Project Cost: \$	5,00



Field Observations

Intersection Issues		Crosswalk			Possible Solutions	
Intersection issues	Ν	E	S	W		
Path of travel pavement condition Path of travel running slope is greater than 5% Path of travel cross slope is greater than 2% for stop control approaches	All driveway path of travel issues and possible solutions provided in driveway shapefile (TRPEDDRV)					
Path of travel cross slope is greater than 5% for free-flow approaches. Crosswalk width is less than 6' Crosswalk striping condition						
Curb Pamp leques	Curb Ram	ip ID ('z' or ' <i>i</i> ' ii		ndicates no	Possible Solutions	

Curb Ramp Issues		existing ramp)		Possible Solutions	
	1A	2A			
Curb ramp does not exist and is needed					
Curb ramp does not land in crosswalk					
No 4' x 4' clear space at base of curb ramp					
Curbed side is not 90° or has traversable adjacent surface	. <u>.</u>				
Flare cross slope is greater than 10%					
Curb ramp running slope is greater than 8.3%					
Blended transition running slope is greater than 5%					
Cut-thru ramp running slope is greater than 5%	<u> </u>			Remove and replace curb ramp	
Curb ramp cross slope is greater than 2%					
Cut-thru ramp cross slope is greater than 2%	<u> </u>				
Curb ramp width is less than 48"	X				
Cut-thru ramp width is less than 60"					
Permanent obstruction (>0.25") in curb ramp/landing/flares		Х			
Temporary obstruction (>0.25") in curb ramp/landing/flares					
No textured surface at base of curb ramp	X	Х		For intersection, commercial driveway, and park ramps, insta	
No color contrast at base of curb ramp	X	Х		color truncated domes	
Landing area does not exist and is needed					
Landing area is less than 5' x 5' or slopes greater than 2%	X	Х		Remove and replace landing area	
Curb ramp transition onto roadway is greater than 0.25"	_				
Counter slope of the gutter or street at the foot of the curb ramp is					
greater than 5%					
Ponding occurs at base of curb ramp					

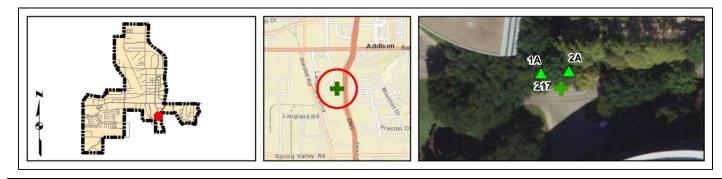

Ramp 1A



Ramp 2A

Opinion of Probable Construction Cost Disclaimer:

The Engineer has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Engineer at this time and represent only the Engineer's judgment as a design professional familiar with the construction industry. The Engineer cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

Project Location Map Sources:

Esri, DeLorme, NAVTEQ, USGS, Intermap, iPC, NRCAN, Esri Japan, METI, Esri China (Hong Kong), Esri (Thailand), TomTom, 2013, DigitalGlobe, GeoEye, i-cubed, USDA, AEX, Getmapping, Aerogrip, IGN, IGP, swisstopo, and the GIS User Community