
Kimley-Horn and A Project Description	Associates, Inc. n for Unsignalized Intersection	Priority: 5						
i roject bescription	Tor onsignalized intersection							
Client:	Town of Addison			Date: 1/2/18				
Program:	ADA Self-Evaluation and Transition Plan			Prepa	ared By: CMP			
KHA No.:	063543021				Cheo	ked By: EPE		
Corridor :	Belt Line Rd							
Project Name:	Belt Line Rd GPS ID: 173 Intersection of Belt Line Rd and driveway (Lat. 32.9543; Long96.8377)							
Town:	Addison							
Item No.	Item Description	Quantity	Unit	ι	Jnit Price	Item Cost		
TxDOT 110-6001	EXCAVATION (ROADWAY)	0	CY	\$	10.00 \$	-		
TxDOT 529-6002	CONC CURB (TY II)	0	LF	\$	15.00 \$	-		
TxDOT 531-6001	CONC SIDEWALKS (4")	0	SY	\$	45.00 \$	-		
TxDOT 531	CURB RAMPS	2	EA	\$	1,500.00 \$	3,000.00		
TxDOT 5003-6002	RETROFIT DET WARN SURF (CAST IN PLACE)	0	SF	\$	50.00 \$	-		
TxDOT 104-6015	REMOVING CONC (SIDEWALKS)	18	SY	\$	9.00 \$	162.00		
TxDOT 677	ELIM EXT PAVE MRK & MRKS	0	LF	\$	2.80 \$	-		
TxDOT 666/678	REFL PAV MRK PREP, TY I & TY II (W) 24"(SLD)	0	LF	\$	8.50 \$	-		
	REPAVE ROADWAY	0	LS	\$	5,000.00 \$	-		
	FIX PONDING	1	LS	\$	2,000.00 \$	2,000.00		
	FIX CURB RAMP TRANSITION	1	LS	\$	2,000.00 \$	2,000.00		
	MEDIAN NOSE MODIFICATION	0	LS	\$	5,000.00 \$	-		
	REMOVE TEMPORARY OBSTRUCTION	0	LS	\$	500.00 \$	-		
	FIX CURB RAMP COUNTER SLOPE	0	LS	\$	2,000.00 \$	-		
Basis for Cost Proje				Subtotal: \$	7,162.00			
	No Design Completed		ngineering: (%		1,919.00			
	Preliminary Design	C	ontingency: (%	,	1,919.00			
	Final Design			Estimate	d Project Cost: \$	11,000.00		

## Project Location

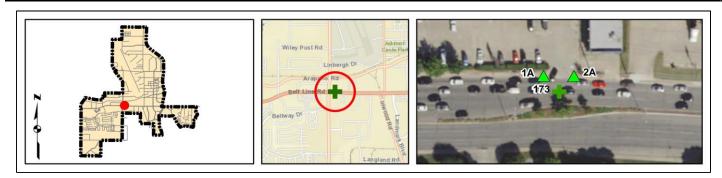

## Field Observations

Intersection Issues		Cros	swalk		Possible Solutions	
Thersection issues	Ν	E	S	W	Possible Solutions	
Path of travel pavement condition Path of travel running slope is greater than 5% Path of travel cross slope is greater than 2% for stop control approaches	All driveway path of travel issues and possible solutions provided in driveway shapefile (TRPEDDRV)					
Path of travel cross slope is greater than 5% for free-flow approaches Crosswalk width is less than 6' Crosswalk striping condition						
Curb Ramp ID ('z' or 'j' in ramp label indicates no						

Curb Ramp Issues		existing ramp)		Possible Solutions	
	1A	2A			
Curb ramp does not exist and is needed					
Curb ramp does not land in crosswalk					
No 4' x 4' clear space at base of curb ramp	. <b>.</b>				
Curbed side is not 90° or has traversable adjacent surface					
Flare cross slope is greater than 10%					
Curb ramp running slope is greater than 8.3%					
Blended transition running slope is greater than 5%					
Cut-thru ramp running slope is greater than 5%	<u> </u>			Remove and replace curb ramp	
Curb ramp cross slope is greater than 2%	Х				
Cut-thru ramp cross slope is greater than 2%	<u> </u>				
Curb ramp width is less than 48"	<u> </u>				
Cut-thru ramp width is less than 60"					
Permanent obstruction (>0.25") in curb ramp/landing/flares		Х			
Temporary obstruction (>0.25") in curb ramp/landing/flares					
No textured surface at base of curb ramp	X	Х		For intersection, commercial driveway, and park ramps, install	
No color contrast at base of curb ramp					
Landing area does not exist and is needed		~		Demous and evaluate leading area	
Landing area is less than 5' x 5' or slopes greater than 2%		X		Remove and replace landing area	
Curb ramp transition onto roadway is greater than 0.25"		Х		Fix curb ramp transition	
Counter slope of the gutter or street at the foot of the curb ramp is					
greater than 5%					
Ponding occurs at base of curb ramp	1	Х		Fix ponding	



Ramp 1A



Ramp 2A

## Opinion of Probable Construction Cost Disclaimer:

The Engineer has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Engineer at this time and represent only the Engineer's judgment as a design professional familiar with the construction industry. The Engineer cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

## Project Location Map Sources:

Esri, DeLorme, NAVTEQ, USGS, Intermap, iPC, NRCAN, Esri Japan, METI, Esri China (Hong Kong), Esri (Thailand), TomTom, 2013, DigitalGlobe, GeoEye, i-cubed, USDA, AEX, Getmapping, Aerogrip, IGN, IGP, swisstopo, and the GIS User Community