Kimley-Horn and Associates, Inc. Project Description for Unsignalized Intersection Priority: 5

Client: Town of Addison Date: 1/2/18 Prepared By: CMP Checked By: EPE Program: ADA Self-Evaluation and Transition Plan KHA No.: 063543021

Brookwood Ln Intersection of Brookwood Ln and Cambridge Ct Corridor : Project Name: Town: GPS ID: 288 Addison


Item No.	Item Description	Quantity	Unit	Unit Price	Item Cost
TxDOT 110-6001	EXCAVATION (ROADWAY)	0	CY	\$ 10.00	\$ -
TxDOT 529-6002	CONC CURB (TY II)	0	LF	\$ 15.00	\$ -
TxDOT 531-6001	CONC SIDEWALKS (4")	0	SY	\$ 45.00	\$ -
TxDOT 531	CURB RAMPS	5	EA	\$ 1,500.00	\$ 7,500.00
TxDOT 5003-6002	RETROFIT DET WARN SURF (CAST IN PLACE)	0	SF	\$ 50.00	\$ -
TxDOT 104-6015	REMOVING CONC (SIDEWALKS)	15	SY	\$ 9.00	\$ 135.00
TxDOT 677	ELIM EXT PAVE MRK & MRKS	0	LF	\$ 2.80	\$ -
TxDOT 666/678	REFL PAV MRK PREP, TY I & TY II (W) 24"(SLD)	238	LF	\$ 8.50	\$ 2,023.00
	REPAVE ROADWAY	0	LS	\$ 5,000.00	\$ -
	FIX PONDING	0	LS	\$ 2,000.00	\$ -
	FIX CURB RAMP TRANSITION	1	LS	\$ 2,000.00	\$ 2,000.00
	MEDIAN NOSE MODIFICATION	0	LS	\$ 5,000.00	\$ -
	REMOVE TEMPORARY OBSTRUCTION	0	LS	\$ 500.00	\$ -
	FIX CURB RAMP COUNTER SLOPE	0	LS	\$ 2,000.00	\$ -
Basis for Cost Proje	ection			Subtotal: 9	\$ 11 658 00

✓ No Design Completed✓ Preliminary Design

☐ Final Design

20% \$ 20% \$ Engineering: (% +/-) Contingency: (% +/-) 2,671.00 2,671.00 **17,000.00** Estimated Project Cost:

## Project Location

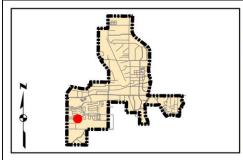





## Field Observations

Intersection Issues		Cros	swalk		Possible Solutions
		N E S		W	Possible Solutions
Path of travel pavement condition	Good	Good	N/A	Good	
Path of travel running slope is greater than 5%			N/A		
Path of travel cross slope is greater than 2% for stop control		N/A	N/A	N/A	
approaches		14//	1 47 1	1 4// (	
Path of travel cross slope is greater than 5% for free-flow approaches.	N/A		N/A		
Crosswalk width is less than 6'	N/A	N/A	N/A	N/A	Install crosswalk pavement markings
Crosswalk striping condition	None	None	N/A	None	install crosswalk pavement markings

Curb Ramp ID ('z' or 'i' in ramp label indicates no							
Curb Ramp Issues		existing ramp)				Possible Solutions	
The country of the co	1A	2A	3 <i>z</i>	4z	·-·····F/		
Curb ramp does not exist and is needed	ī	<u> </u>	Х	Х	Ins	tall curb ramp; if median improvement, see shapefile	
Curb ramp does not land in crosswalk	i						
No 4' x 4' clear space at base of curb ramp	Ĭ						
Curbed side is not 90° or has traversable adjacent surface	I						
Flare cross slope is greater than 10%	X						
Curb ramp running slope is greater than 8.3%	I	Х					
Blended transition running slope is greater than 5%	ļ						
Cut-thru ramp running slope is greater than 5%	i .				Ra	move and replace curb ramp	
Curb ramp cross slope is greater than 2%	I	Х			1/6	move and replace curb ramp	
Cut-thru ramp cross slope is greater than 2%	ļ						
Curb ramp width is less than 48"	X	X					
Cut-thru ramp width is less than 60"	I						
Permanent obstruction (>0.25") in curb ramp/landing/flares	<u> </u>						
Temporary obstruction (>0.25") in curb ramp/landing/flares	<u>.i</u>		<u> </u>	<u> </u>	<u></u>		
No textured surface at base of curb ramp	X	Х	ļ	<u>                                     </u>		r intersection, commercial driveway, and park ramps, install	
No color contrast at base of curb ramp	Х	X	<b> </b>	<b></b>	L	or truncated domes	
Landing area does not exist and is needed	X	X	<u> </u>	ļ <u>.</u>	Ins	tall landing area	
Landing area is less than 5' x 5' or slopes greater than 2%	<u> </u>	<b></b>	<b> </b>	<u> </u>	<u></u> .		
Curb ramp transition onto roadway is greater than 0.25"	X	ļ	ļ	ļ	Fix	curb ramp transition	
Counter slope of the gutter or street at the foot of the curb ramp is	İ						
greater than 5%	<u> </u>	<u> </u>	<u> </u>				
Ponding occurs at base of curb ramp	T			T1			

**Photographs** 

288



Ramp 1A



Corner 3 No Ramp (3z)



Ramp 2A



Corner 4 No Ramp (4z)

## Opinion of Probable Construction Cost Disclaimer:

The Engineer has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Engineer at this time and represent only the Engineer's judgment as a design professional familiar with the construction industry. The Engineer cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

## Project Location Map Sources:

Esri, DeLorme, NAVTEQ, USGS, Intermap, iPC, NRCAN, Esri Japan, METI, Esri China (Hong Kong), Esri (Thailand), TomTom, 2013, DigitalGlobe, GeoEye, i-cubed, USDA, AEX, Getmapping, Aerogrip, IGN, IGP, swisstopo, and the GIS User Community