
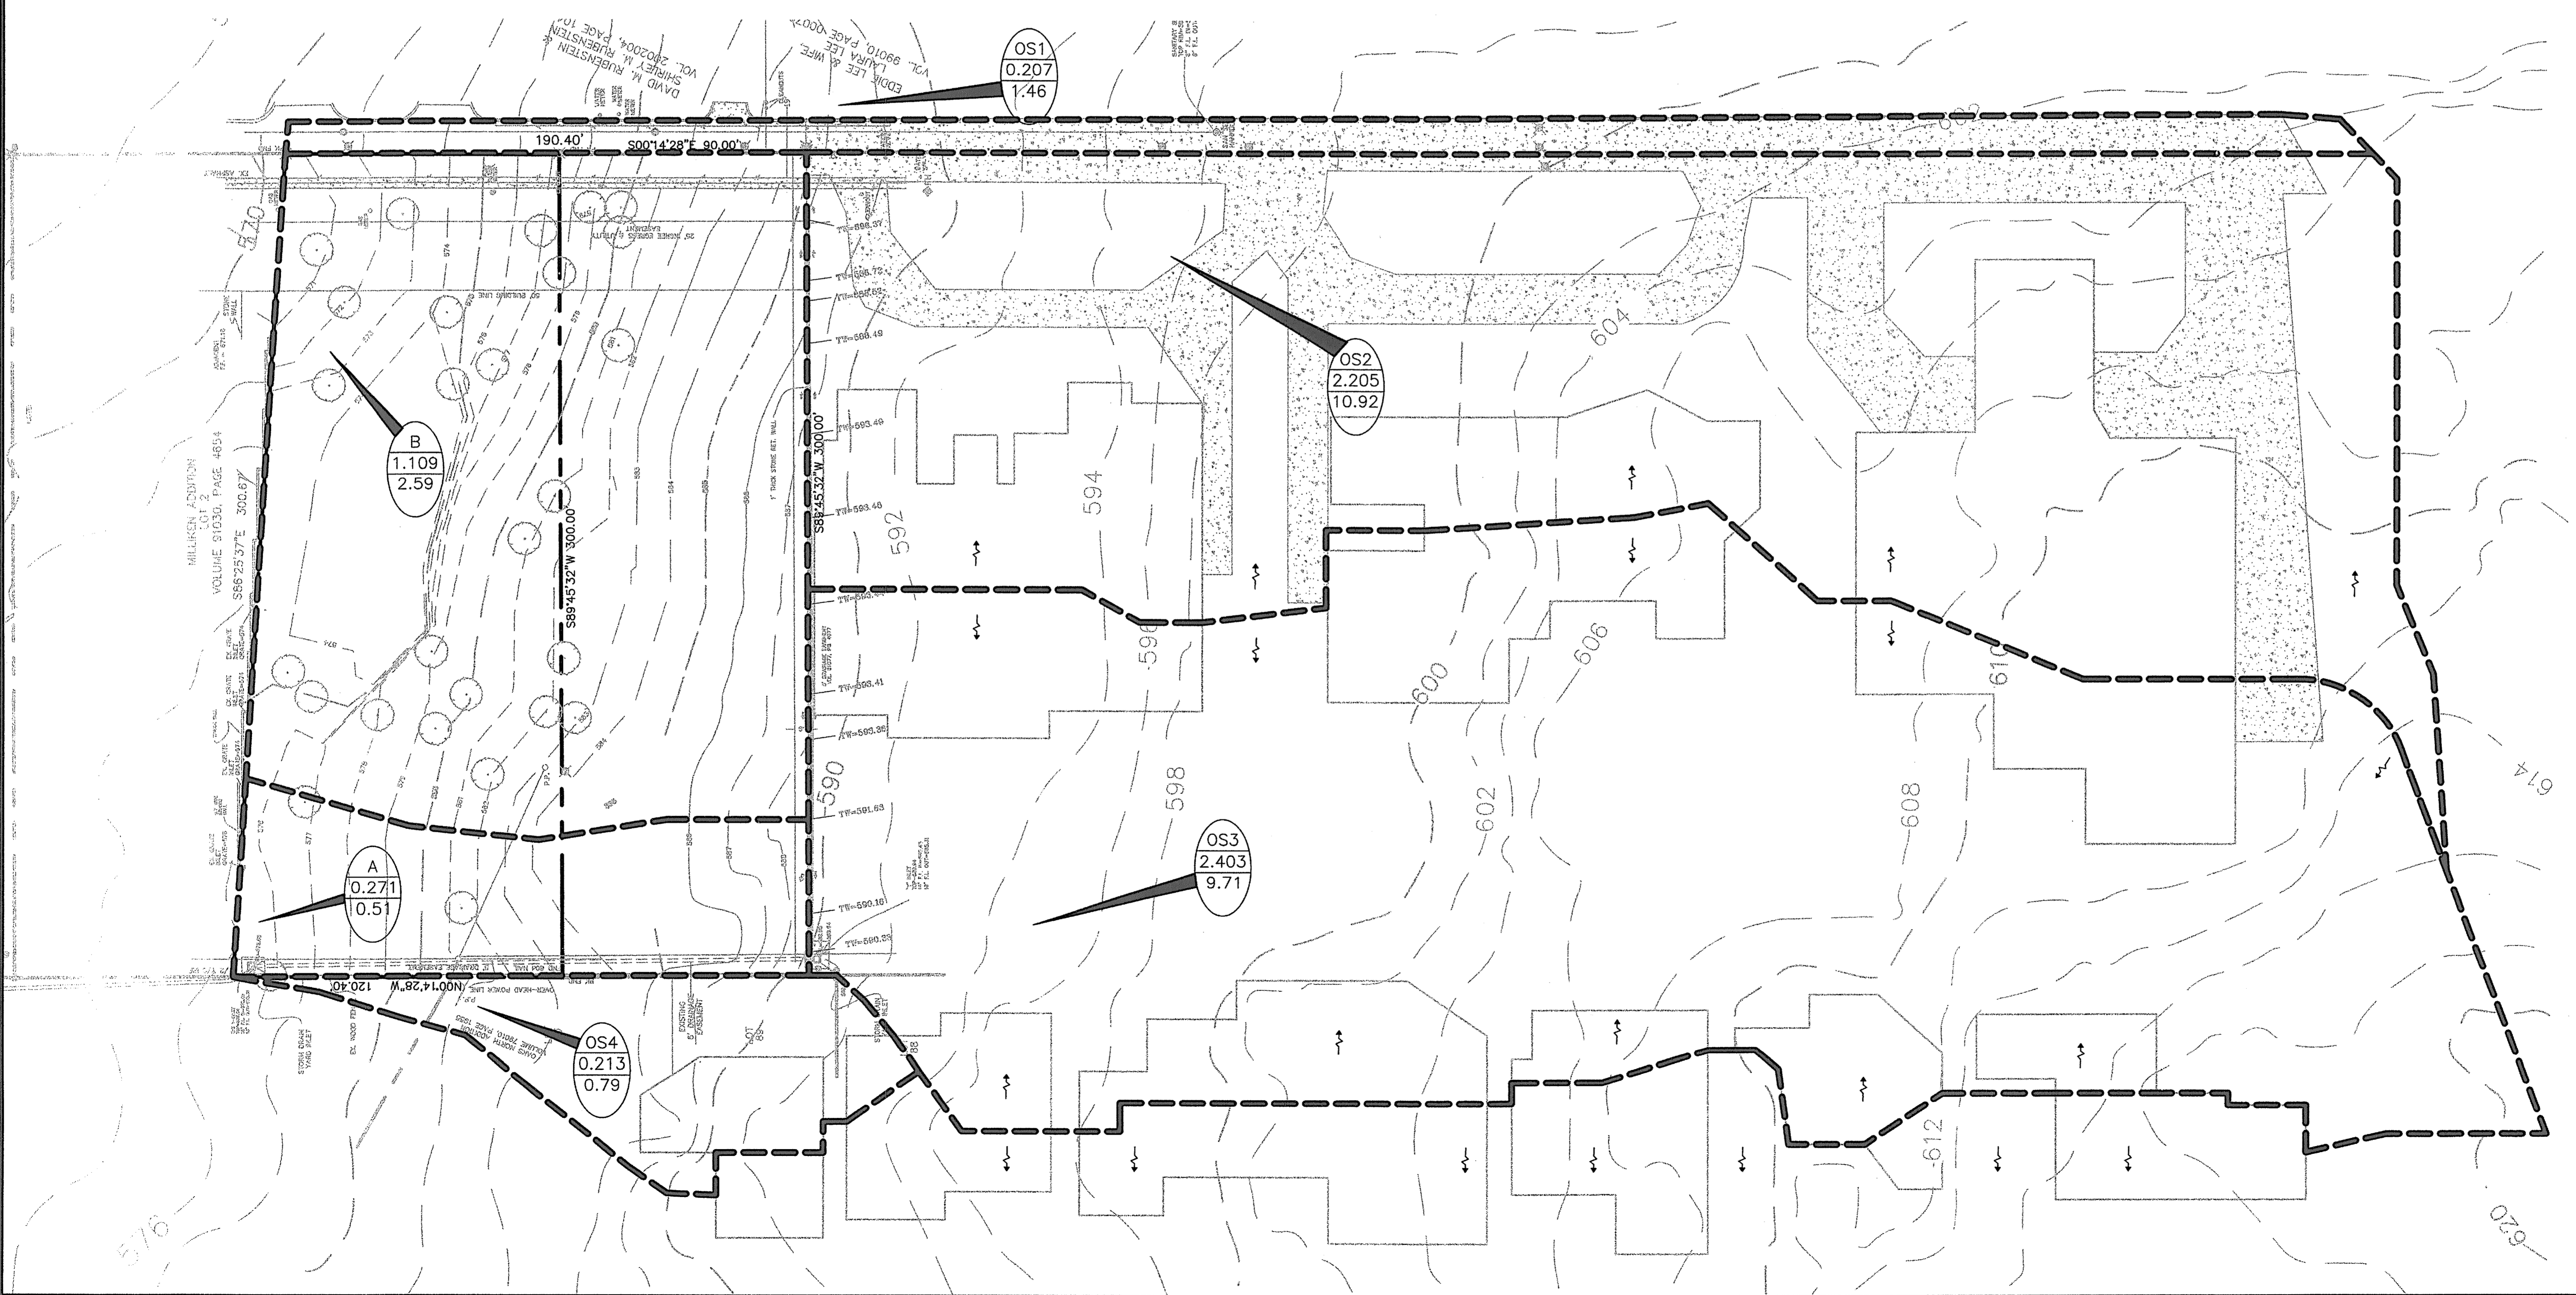
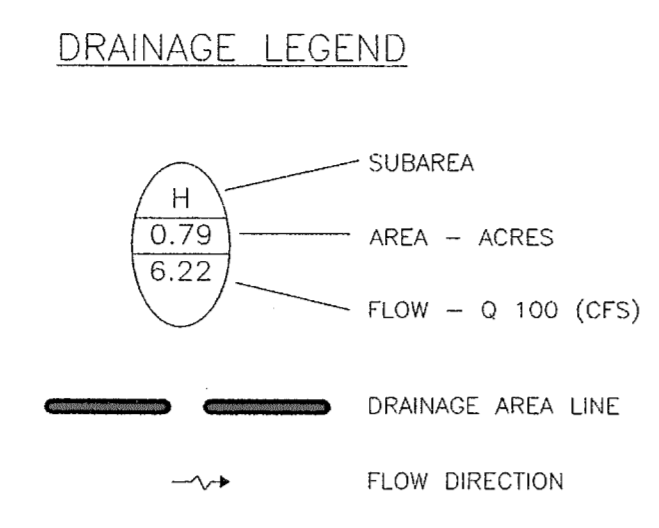


PRE DEVELOPED DRAINAGE SUMMARY										
100 YEAR STORM EVENT										
LAKE FOREST DRIVE - ADDISON TEXAS										
DRAINAGE AREA	IMPERVIOUS AREA C=0.95	PERVIOUS AREA C=0.25	TOTAL AREA (ac)	C IMPERVIOUS	C PERVIOUS	WEIGHTED C VALUE	Tc	I(100) (IN/HR)	Q (100) (cfs)	REMARKS
<b>ON-SITE DRAINAGE</b>										
A	0.000	0.271	0.271	0.95	0.25	0.25	15	7.52	0.51	DRAINS TOWARDS NW PROP CORNER
B	0.096	1.013	1.109	0.95	0.25	0.31	15	7.52	2.59	DRAINS TOWARDS LAKE FOREST DRIVE
<b>OFF-SITE DRAINAGE</b>										
OS-1	0.204	0.003	0.207	0.95	0.25	0.94	15	7.52	1.46	LAKE FOREST DRIVE DRAINAGE
OS-2	1.286	0.920	2.206	0.95	0.25	0.66	15	7.52	10.92	TOWARDS SWALE IN LAKE FOREST DR.
OS-3	0.987	1.416	2.403	0.95	0.25	0.54	15	7.52	9.71	TO INLET NEAR SWC OF OUR PROPERTY
OS-4	0.074	0.138	0.212	0.95	0.25	0.49	15	7.52	0.79	TO INLET AT NW PROP CORNER

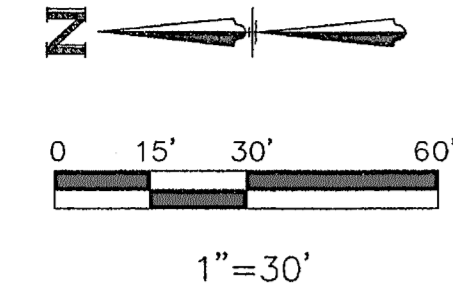

**LOT 1B, MILLIKEN ADDITION**  
 VICTOR MEYER CUSTOM HOMES, LLC  
 MICHAEL AND RACHEL HARDIN  
 14905 LAKE FOREST DRIVE  
 ADDISON, TEXAS

Revisions:

#	Date Issued:	Description:

Sheet Title:  
**PRE-DEVELOPED DRAINAGE AREA MAP**  
 Date: August 7, 2009  
 Project Number: 09015.0  
 Drawn By: TJB

Sheet Number:  
**C-3.0**