

ADDISON AIRPORT		
BUI	LDING REPORT	
Facility Information:	Facility Name: Cavanaugh Flig	ght Museum - Hangar 2
Facility Contact: Lisa Pyles	Contact Phone: 972-450-2878	
Accessology Inspector Information:		
Inspector: Karen Jackson Email: Kjackson@accessology.com	Da	te: April 17, 2017
Latitude: 32.972295	Longitude: -96.834397	
Address: 4572 Clair Chenault Street	City: Addison	County: Dallas
There is no parking specifically the report for the main museum Total Parking Spaces: Total Accessible Parking Spaces: Number of van accessible spaces: Is the accessible parking substantially compliant?	y associated with this hanger. Parking building.	N/A N/A N/A N/A N/A
Parking Violations Total \$0	High Priority Medium Priori Low Priority	ity <u>5-8</u>

ADDISON AIRPORT BUILDING REPORT		
Facility Information:	Facility Name: Cavanaugh Fli	ght Museum - Hangar 2
Facility Contact: Lisa Pyles	Contact Phone: 972-450-2878	
Accessology Inspector Information:		
Inspector: Karen Jackson Email: Kjackson@accessology.com	Da	ate: April 17, 2017
Latitude: 32.972295	Longitude: -96.834397	
Address: 4572 Clair Chenault Street	City: Addison	County: Dallas
The route to the building entrance is substantially compliant. Is the path of travel from accessible parking to building entrance compliant? Does the path of travel serve all exterior amenities offered by the facility? Is the path of travel from building entrances to all amenities served by the entrance substantially compliant?		
Accessible Route Total \$0	High Priorit Medium Prior Low Priority	ity <u>5-8</u>

ADDISON AIRPORT BUILDING REPORT			
Facility Information:		Facility Name: Cavanaugh Fli	ght Museum - Hangar 2
Facility Contact: L	isa Pyles	Contact Phone: 972-450-2878	
Accessology Inspector In	formation:		
Inspector: K Email: K	aren Jackson jackson@accessology.com	Da	ate: April 17, 2017
Latitude: 32	2.972295	Longitude: -96.834397	
Address: 4	572 Clair Chenault Street	City: Addison	County: Dallas
General Entrance Notes:	:		
Т	he entrance into the facility ha	as non-compliant slopes.	
of the nearest accessible Violation #1: T Standard:	r that is accessible? le door have signage indicati door? the entrance into Hanger #2 ha 2010 ADAAG 404.2.4.4	as a 11.9% slope at the door. 4 Floor or Ground Surface. within required maneuvering cleara	
comply with 302. Changes in level are not permitted. EXCEPTIONS: Slopes not steeper than 1:48 shall be permitted. Remove and replace pavement in front of the door to achieve a 2% slope in all directions.			
Violation #1 Cost:	\$2,625	Priority Level 3 High Priorit	y 1-4
Entrance Total	\$2,625	Medium Prior	<u> </u>

		DISON AIRPORT LDING REPORT	
Facility Information:		Facility Name: Cavanaugh F	light Museum - Hangar 2
Facility Contact:	Lisa Pyles	Contact Phone: 972-450-287	8
Accessology Inspector	Information:		
-	Karen Jackson Kjackson@accessology.com	I	Date: April 17, 2017
Latitude:	32.972295	Longitude: -96.834397	
Address:	4572 Clair Chenault Street	City: Addison	County: Dallas
General Hallway Note	s:		
	There are no hallways provided	d in this facility.	
_	per maneuvering clearances? t least 36" clear width? vided? ing objects? tially compliant? There is a storage room in the hardware.	office portion of the facility that hat books and Gate Hardware	
Text:	Handles, pulls, latches, shall comply with 309.4	locks, and other operable parts on 4.	doors and gates
Possible Solutions:	Replace hardware with	lever hardware.	
Violation #2 Cost:	\$525	Priority Level 2	
Hallway Total	\$525	High Prior Medium Prior Low Prior	ority 5-8


Summary Sheet for Cavanaugh Flight Museum - Hangar 2

Cavanaugh Flight Museum - Hangar 2

#	VIOLATION SUMMARY	PRIORITY LEVEL	COST
1	Remove and replace pavement in front of the door to achieve a 2% slope in all directions.	Level 3	\$2,625.00
2	Replace hardware with lever hardware.	Level 2	\$525.00

Grand Total	\$3,150.00



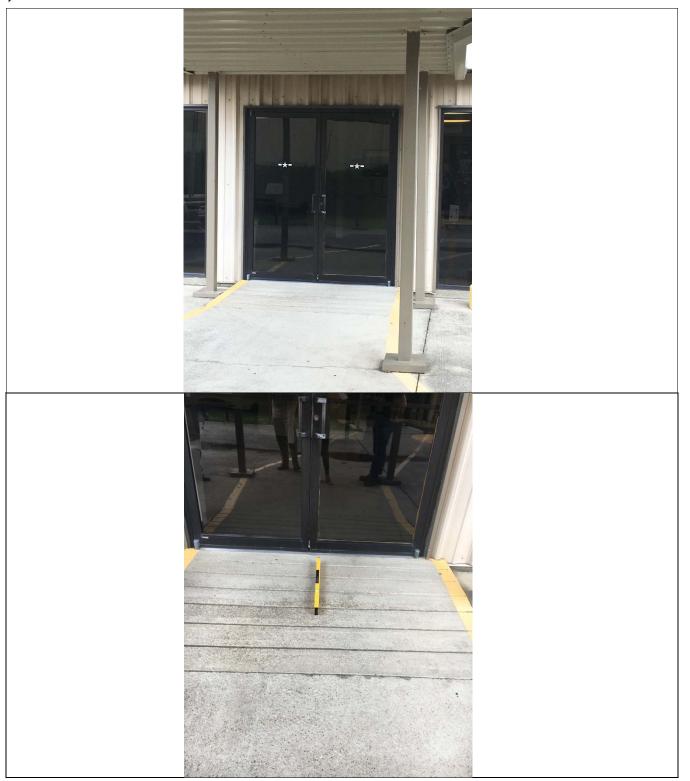





Violation 1 -The entrance into Hanger #2 has a 11.9% slope at the door.



Violation 2 - There is a storage room in the office portion of the facility that has knob hardware.